



NUMBER: 19-005-07

GROUP: Steering

DATE: November 13, 2007

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler LLC.

**SUBJECT:** Проблема: Скрипит рулевой колонки в районе моторного щита  
Steering Column Dash Seal Squeak/Rubbing Sound

**OVERVIEW:** Обзор: Этот бюллетень включает в себя проверку скрипов  
This bulletin involves verifying the squeak/rubbing is originating from the lower steering column shaft seal, inspecting the seal and either cleaning and lubricating the seal and collar or cleaning the collar and replacing the seal.

**MODELS:** Исходящих из нижнего уплотнения вала рулевой колонки, проверка  
уплотнения, штыки, смазка уплотнения и втулки или штыки  
втулки и замена уплотнения.  
2005 - 2007 LX 300C/Magnum/Charger  
2006 - 2007 LE 300C/300C Touring Edition  
2007 L2 300C (China)

**NOTE:** This bulletin applies to left hand drive (LHD) vehicles only.

**SYMPTOM/CONDITION:** Симптомы: Владелец может пожаловаться на  
The vehicle operator may experience a squeak/rubbing sound originating from the lower steering shaft dash seal. The sound may be due to a lack of lubricant.


Скрипит исходящих из уплотнения в моторном щите рулевой колонки. Причина отсутствия смазки.

**DIAGNOSIS:**

If the customer complains of a squeak/rubbing sound, verify that it is coming from the lower dash seal. if so:

1. Remove the 2 push pins from the lower hush panel below the steering column
2. Remove hush panel to gain access to lower steering column seal
3. Pull the steering column seal down and inspect the white cup the seal rides on.
4. Does the white cup have black markings on white cup in the area shown in (Fig. 1) below?

Если скрипит действительно исходит из этого уплотнения, в этом случае: смотри рисунок 1

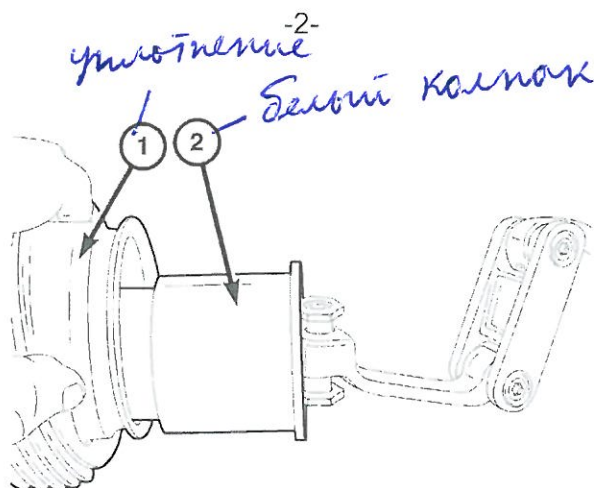

Снять уплотнение с колпачка и сложить сложной  
нижней кромке уплотнения и сальника колпак

Fig. 1 BLACK MARKING ON WHITE CUP

- 1 - STEERING COLUMN DASH SEAL  
2 - WHITE CUP (AREA OF BLACK MARKINGS)

- a. No >>> Perform Repair Procedure A  
b. Yes >>> Perform Repair Procedure B

**PARTS REQUIRED:**

Qty.	Part No.	Description
(AR) 1	05166448AA	Steering Boot
(AR) 1*	05170263AB	Steering Boot Kit
1	68028730AA	Grease - 2 oz. Tube
1	04897150AB	Mopar Brake Parts Cleaner - Non-Chlorinated 15 oz Can (1 can will service 25 vehicles)
1	06507656AA	Bolt, Forward Steering Column Mount, M8
1	06101695	Nut, Forward Steering Column Mount, M8
2	06508125AA	Bolts, Rearward Steering Column Mount, M8

**NOTE:** \* P/N 05170263AB is a kit that contains an Instruction sheet. For the purpose of this bulletin, DISREGARD the Instruction sheet included in the kit and follow Repair Procedure "B" instructions only (if replacing boot).

**REPAIR PROCEDURE A - CLEAN AND LUBRICATE:**

1. While the seal is down, clean seal lip and white cup.
2. Apply grease p/n 68028730AA to cup.

**CAUTION:** Do not use any other type of grease as it may adversely react to the seal material.